


ENTIRE COMBINATION METER DOES NOT OPERATE

WIRING DIAGRAM

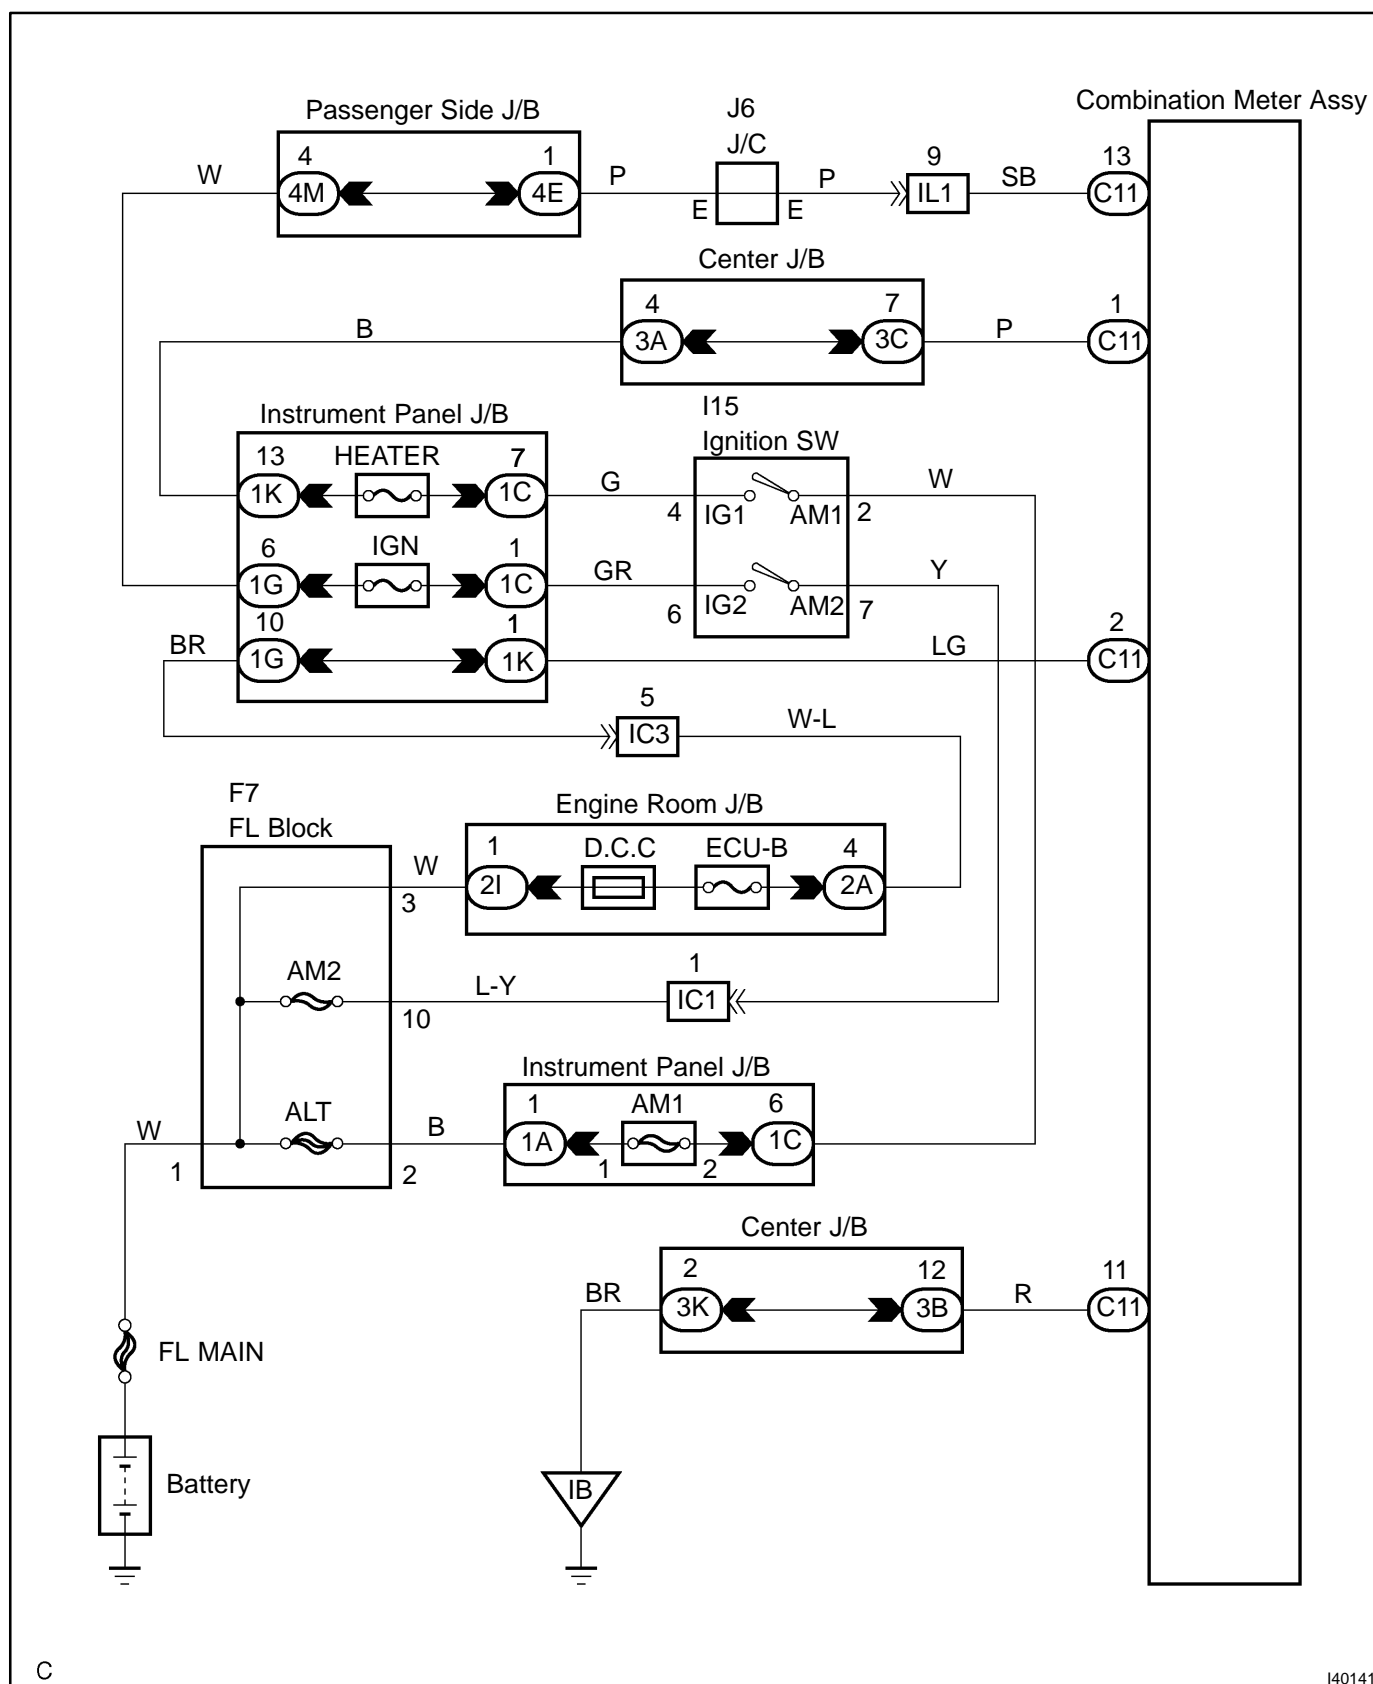


C

I40141

INSPECTION PROCEDURE

1 INSPECT COMBINATION METER ASSY

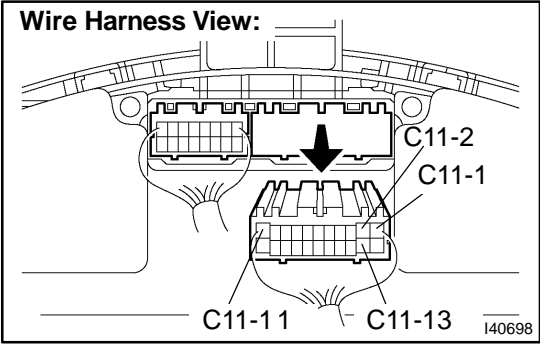

- (a) Measure the resistance according to the value(s) in the table below.

Standard:

Terminal No	Condition	Specified condition
C11-11 - Body ground	Always	Below 1 Ω

- (b) Measure the voltage according to the value(s) in the table below.

Standard:

Terminal No	Condition	Specified condition
C11-2 - Body ground	Always	10 to 14 V
C11-1 - Body ground	Ignition switch ON	10 to 14 V
C11-13 - Body ground	Ignition switch ON	10 to 14 V

NG

REPAIR OR
CONNECTOR

REPLACE HARNESS OR

OK

REPLACE COMBINATION METER ASSY(SEE PAGE 71-18)